

# HV-7000PW6

## 70MHz HIGH VOLTAGE DIFFERENTIAL PROBE

### USER'S MANUAL

This probe is in compliance with IEC-61010-031 CAT. I, Pollution Degree 2.

## 1. Safety Terms and Symbols

Terms appear in this manual:




---

WARNING. Warning statements identify conditions or practices that could result in injury or loss life.

---




---

CAUTION. Caution statements identify conditions or practices that could result in damage to this product or other property.

---

Symbols appear on the product:



Danger  
High Voltage



Protective  
(Earth) Terminal



Attention  
Refer to Manual

## 2. General Safety Summary

Review the following safety precautions to avoid injury and prevent damage to this probe or any products that connected to it.

### Observe maximum working voltage

To avoid any injury, do not use the probe above 2500Vrms CAT I between each input lead and earth or above 5000Vrms CAT I between two inputs. This voltage rating applies to both of 1/100 & 1/1000 settings.

**Must be grounded**

This probe is grounded with the shell of BNC connector and an auxiliary grounding terminal, through the grounding conductor of the power cord of the measurement instrument.

Before making connections to the input leads of this probe, ensure that the output BNC connector is attached to the BNC connector of the measurement instrument and the auxiliary grounding terminal is connected to a proper ground, while the measurement instrument is properly grounded.

**Use fused test prods if necessary**

If this probe is intended to use for measurements in circuits of INSTALLATION CATEGORY III, it should incorporate with fused test prods.

**Do not operate without covers**

To avoid electric shock or fire hazard, do not operate this probe with covers removed.

**Do not operate in wet/damp conditions**

To avoid electric shock, do not operate this probe in wet or damp conditions.

**Do not operate in explosive atmosphere**

To avoid injury or fire hazard, do not operate this probe in an explosive atmosphere.

**Avoid exposed circuit**

To avoid injury, remove jewelry such as rings, watches, and other metallic objects. Do not touch exposed connections and components when power is present.

**Use proper power source**

To ensure this probe function well, use four AA cells or 6VDC/200mA or regulated 9VDC/120mA mains adaptor or power leads.

**Do not operate with suspected failures**

If you suspect there is damage to this probe, have it inspected by qualified service personnel.

### 3. Description

By enabling conventional oscilloscopes to display and measure in-circuit waveforms that are referenced to high common mode voltages. The differential probe extends the measurement capability of oscilloscopes in electronic power converters, inverters, motor speed controls, switch mode power supplies and many applications.

### 4. Installation

- a. Simply plug-in the output BNC connector of this probe to the vertical input of a general purposed oscilloscope or other measurement instrument, and connects the auxiliary grounding terminal to a proper ground. The measurement instrument must have a ground referenced.
- b. Install four AA cells or connect an appropriate power source to this probe.
- c. Select the proper attenuation ratio. When measuring signals below 700V, switch the attenuation ratio to 1/100 in order to get higher resolution and less noise ratio. Otherwise, set the attenuation ratio to 1/1000.




---

**WARNING.** To protect against electric shock, use only the accessories supplied with this probe.

---

- d. Using the appropriate probe accessories, connect the inputs to the circuits under measurement.





---

**CAUTION.** This probe is carry out differential measurement between two points on the circuit under measurement. This probe is not for electrically insulating the circuit under measurement and the measuring instrument.

---

## 5. Appearance

The differential probe looks as follows.

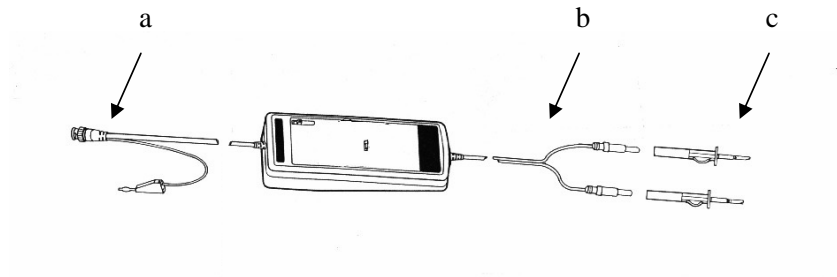


- a. Output Lead      The BNC output connector and an auxiliary grounding terminal are connected to the oscilloscope.
- b. Input Leads      The input leads of the differential probe connect to sprung hooks that come with the probe.
- c. Sprung Hooks      The sprung hooks are connected safely to test points in circuits under measurement.

## 6. Power Leads

We offer two types power leads;

- a. Lemo® Lead: For the oscilloscope whose power connector is Lemo® connector.
- b. Probus® Lead: For the oscilloscope whose power connector is Probus® connector.

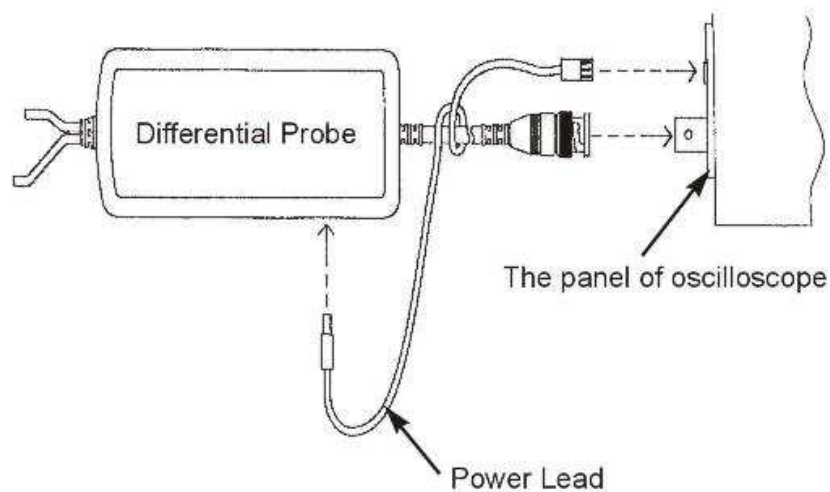

## 7. Specifications


Bandwidth	DC to 70MHz (-3dB)
Attenuation	1:100/1000
Accuracy	±2%
Input Impedance	10MΩ//10pF each side to ground
Input Voltage	
- Differential Range*	±700V(DC+Peak AC) or 700Vrms @1/100 ±7000V(DC+Peak AC) or 5000Vrms @1/1000
- Common Mode Range*	±7000V(DC+Peak AC) or 2500Vrms @1/100 & 1/1000
- Absolute Max. Voltage*	±7000V(DC+Peak AC) or 2500Vrms @1/100 & 1/1000 in common mode ±7000V(DC+Peak AC) or 5000Vrms @1/100 & 1/1000 in differential mode
Output Voltage	
- Swing (into 50kΩ load)	±7V
- Offset (typical)	<±5mV
- Noise (typical)	0.9mVrms
- Source Impedance (typical)	50Ω (for using 1MΩ input system oscilloscope)
CMRR (typical)	-80dB@60Hz, -50dB@1MHz
Ambient Operating Temperature	-10 to 40°C
Ambient Storage Temperature	-30 to 70°C
Ambient Operating Humidity	25 to 85% RH
Ambient Storage Humidity	25 to 85% RH
Power Requirements	
- Standard	4xAA cells or 6VDC/200mA mains adaptor** or regulated 9VDC/120mA mains adaptor**
- Options	Power leads
Length of BNC Cable	90cm
Length of Input Leads	60cm
Weight	500g
Dimension (LxWxH)	202mmx83mmx38mm

\* Voltage limit is the lesser of the DC+Peak AC and RMS values.

- \*\*
- The supplied voltage must be less than 12V and greater than 4.4V, otherwise the probe could be damaged or can't operated properly.
  - Polarity is "+" inside and "-" outside. For wrong polarity, built-in circuit protects the probe, no danger or damage will occur.
  - When the voltage of the cells become too low, the power indicator on the panel will flicker.

## 8. Derating Curve

The derating curve of the absolute maximum input voltage in common mode is shown as follows;

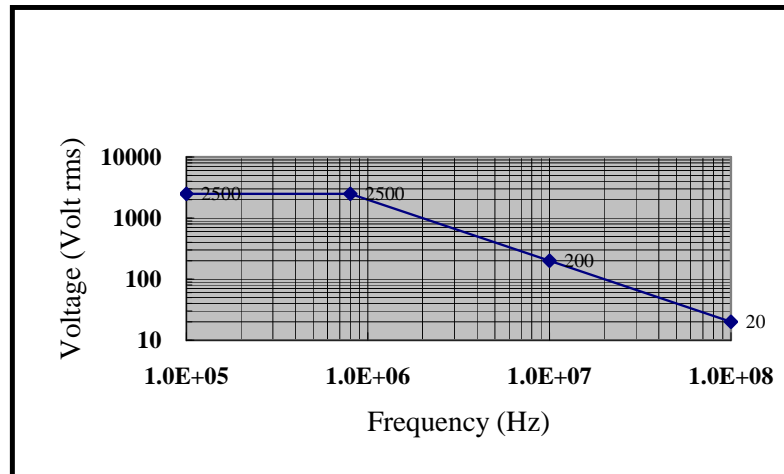

## 9. Overrange Indicator

The overrange indicator lights red, if the voltage of the input signal exceeds the linear operating range of the probe. When this happens, the signal on the probe output may not accurately represent the signal on the probe input.

## 10. Inspection Procedure

- Connect the BNC output connector to the vertical input of a general purposed oscilloscope.
- Install four AA cells or connect an appropriate power source to this probe.
- Set the oscilloscope input to DC coupling and 1V/div. Center the trace on the display.
- Connect the sprung hooks of the probe to power lines.
- Set the range of the probe to 1/100.
- Then, a 50Hz/60Hz sine-wave of proper amplitude will be displayed on the screen of the oscilloscope and this means this probe is working properly.

## 11. Cleaning

Use a soft cloth to clean the dirt. Prevent damage to probe.

- Avoid immersing the probe.
- Avoid using abrasive cleaners.
- Avoid using chemicals contains benzene or similar solvents.

Lemo® and Probus® are registered trademarks.

Date: Aug. 30,2006

Headquarter Switzerland:  
Pewatron AG  
Thurgauerstrasse 66  
CH-8050 Zurich  
Phone +41 44 877 35 00  
info@pewatron.com

Office Germany:  
Pewatron Deutschland GmbH  
Edisonstraße 16  
D-85716 Unterschleißheim  
Phone +49 89 374 288 87-0  
info.de@pewatron.com



**PEWATRON**  
SENSORS · POWER SOLUTIONS

## We are here for you. Addresses and Contacts.

---

### Sales Germany & Austria

Postcode 00000 – 31999  
Postcode 38000 – 39999  
Postcode 80000 – 99999  
Austria

Kurt Stritzelberger

Phone +49 89 260 52 80  
Mobile +49 171 803 41 35

kurt.stritzelberger@pewatron.com

Postcode 32000 – 37999  
Postcode 40000 – 79999

Gerhard Vetter

Phone +49 674 394 75 75  
Mobile +49 163 762 74 30

gerhard.vetter@pewatron.com

**Geometrical sensors**  
**Sensor elements**

Thorsten Ravagni

Phone +49 60 479 53 627

thorsten.ravagni@pewatron.com

---

### Sales Switzerland & Liechtenstein

Postcode 3000 – 9999

Basil Frei

Phone +41 44 877 35 18  
Mobile +41 76 279 37 26

basil.frei@pewatron.com

Postcode 1000 – 2999

Christian Mohrenstecher

Mobile +41 76 444 57 93

christian.mohrenstecher@pewatron.com

### Sales International Key Accounts

Peter Felder

Phone +41 44 877 35 05  
Mobile +41 79 406 49 83

peter.felder@pewatron.com

---

### Sales Other Countries / Product Management

#### Pressure Sensors

Philipp Kistler  
Phone +41 44 877 35 03  
philipp.kistler@pewatron.com

#### Accelerometers / Level Flow sensor elements

Thorsten Ravagni  
Phone +49 60 479 53 627  
thorsten.ravagni@pewatron.com

#### Drive technology CH Postcode 5000 – 9999 / DE

Roman Homa  
Mobile +41 76 444 00 86  
roman.homa@pewatron.com

#### Gas sensors / Gas sensor modules Load cells

Dr. Thomas Clausen  
Phone +41 44 877 35 13  
thomas.clausen@pewatron.com

#### Power supplies

Sebastiano Leggio  
Phone +41 44 877 35 06  
sebastiano.leggio@pewatron.com

#### Drive technology CH Postcode 1000 – 4999 / AT / IT / FR

Christian Mohrenstecher  
Mobile +41 76 444 57 93  
christian.mohrenstecher@pewatron.com

#### Flow / Level / Medical products

Dr. Adriano Pittarelli  
Phone +49 8245 774 95 44  
adriano.pittarelli@pewatron.com

#### Linear position sensors Angle sensors

Eric Letsch  
Phone +41 44 877 35 14  
eric.letsch@pewatron.com

#### Current sensors Power solutions

Osman Coban  
Phone +49 71 635 363 898  
osman.coban@pewatron.com