

SI-9110PW6

100MHz DIFFERENTIAL PROBE

USER'S MANUAL

This probe is in compliance with IEC-61010-031 CAT III, Pollution Degree 2.

1. Safety Terms and Symbols

Terms appear in this manual:



WARNING. Warning statements identify conditions or practices that could result in injury or loss life.



CAUTION. Caution statements identify conditions or practices that could result in damage to this product or other property.

Symbols appear on the product:



Danger
High Voltage



Protective
(Earth) Terminal



Attention
Refer to Manual

2. General Safety Summary

To review the following safety precautions to avoid injury and prevent damage to this probe or any products that connected to it.

Observe maximum working voltage

To avoid any injury, do not use the probe above 1000Vrms CAT III between each input lead and earth or between the two input leads. This voltage rating applies to both of 1/100 and 1/1000 settings.

Must be grounded

This probe is grounded with the shell of BNC connector and an auxiliary grounding terminal, through the grounding conductor of the power cord of the measurement instrument.

Before making connections to the input leads of this probe, ensure that the output BNC connector is attached to the BNC connector of the measurement instrument and the auxiliary grounding terminal is connected to a proper ground, while the measurement instrument is properly grounded.

Use fused test prods if necessary

If this probe is intended to use for measurements in circuits of INSTALLATION CATEGORY III, it should incorporate with fused test prods.

Do not operate without covers

To avoid electric shock or fire hazard, do not operate this probe with covers removed.

Do not operate in wet/damp conditions

To avoid electric shock, do not operate this probe in wet or damp conditions.

Do not operate in explosive atmosphere

To avoid injury or fire hazard, do not operate this probe in an explosive atmosphere.

Avoid exposed circuitry

To avoid injury, remove jewelry such as rings, watches and other metallic objects. Do not touch exposed connections and components when power is present.

Use proper power source

To ensure this probe function well, use four AA cells or 6VDC/200mA mains adaptor or regulated 9VDC/120mA mains adaptor or power leads.

Do not operate with suspected failures

If you suspect there is damage to this probe, have it inspected by qualified service personnel.

3. Description

By enabling conventional oscilloscopes to display and measure in-circuit waveforms that are referenced to high common mode voltages, the differential probe extends the measurement capability of oscilloscopes in electronic power converters, inverters, motor speed controls, switch mode power supplies and many applications.

4. Installation

- a. Simply plug-in the BNC output connector to the vertical input of a general purpose oscilloscope or other measurement instrument, and connects the auxiliary grounding terminal to a proper ground. The measurement instrument must have a ground referenced.
- b. Install four AA cells or connect an appropriate power source to this probe.
- c. Select the proper attenuation ratio, when measuring signals below 140V, switch the attenuation ratio to 1/100 in order to get higher resolution and less noise. Otherwise, set the attenuation to 1/1000.



WARNING. To protect against electric shock, use only the accessory supplied with this differential probe.


- d. Using the appropriate probe accessories, connect the input to the circuits under measurement.



CAUTION. This probe is to carry out differential measurement between two points on the circuit under measurement. This probe is not for electrically insulating the circuit under measurement and the measuring instrument.

5. Appearance

The differential probe looks as follows.

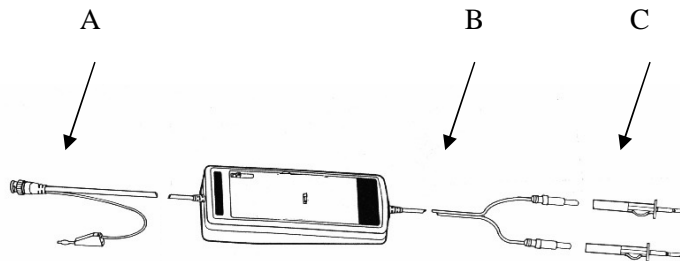


- | | |
|-----------------|---|
| A. Output Lead | The BNC output connector and an auxiliary grounding terminal are connected to the oscilloscope. |
| B. Input Leads | The input leads of the differential probe connect to sprung hooks that come with the probe. |
| C. Sprung Hooks | The sprung hooks are connected safely to test points in circuits under measurement. |

6. Power Leads

We offer two types power leads;

- a. Lemo® Lead: For the oscilloscope whose power connector is Lemo® connector.
- b. Probus® Lead: For the oscilloscope whose power connector is Probus® connector.

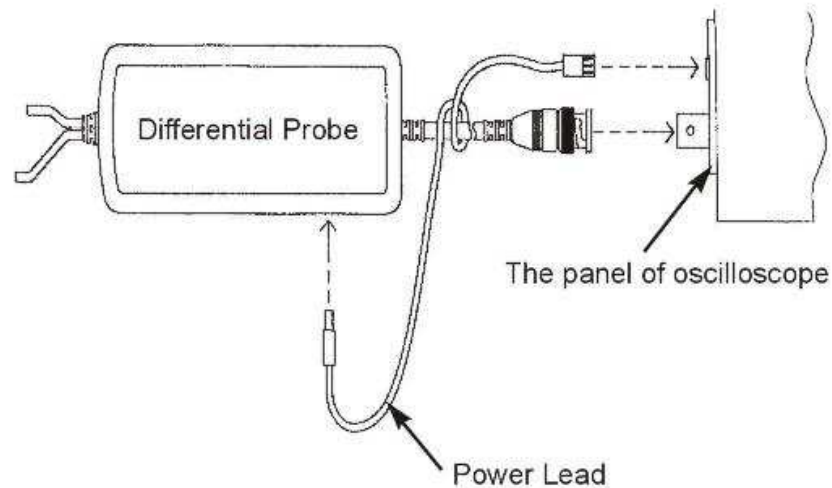

7. Specifications

Bandwidth	DC to 100MHz (-3dB)
Attenuation ratio	1:100/1000
Accuracy	±2%
Rise Time	3.5ns
Input Impedance	4MΩ//7pF each side to ground
Input Voltage	
- Max. Differential*	±140V(DC + Peak AC) or 140Vrms @ 1/100 1400V(DC + Peak AC) or 1000Vrms @ 1/1000
- Common Mode Range*	±1400V(DC + Peak AC) or 1000Vrms @ 1/100 & 1/1000
- Absolute Max. Voltage*	1000Vrms CATIII @ 1/100 & 1/1000
±1400V(DC + Peak AC) or (Differential or Common Mode)	
Output Voltage	
- Swing (into 50kΩ load)	±7V
- Offset (typical)	<±5mV
- Noise (typical)	0.9mVrms
- Source Impedance (typical)	50Ω (for using 1MΩ input system oscilloscope)
CMRR (typical)	-80dB @ 60Hz; -50dB @ 1MHz
Ambient Operating Temperature	-10 to 40°C
Ambient Storage Temperature	-30 to 70°C
Ambient Operating Humidity	25 to 85% RH.
Ambient Storage Humidity	25 to 85% RH.
Power Requirements	
- Standard	4xAA cells or 6VDC/200mA mains adaptor or regulated 9VDC/120mA mains adaptor**
- Option	Power leads
Length of Input Leads	30cm
Length of BNC Lead	90cm
Weight	500gms
Dimension (LxWxH)	207mm x 83mm x 38mm


* Voltage limit is the lesser of the DC+Peak AC and RMS values..

**

- a. The supplied voltage must be less than 12V and greater than 4.4V, otherwise the probe could be damaged or can't be operated properly.
- b. Polarity is "+" inside and "-" outside. For wrong polarity, built-in circuit protects the probe, no danger or damage will occur.
- c. When the voltage of the cells become too low, the power indicator on the panel will flicker.

8. Derating Curve

The derating curve of the absolute maximum input voltage is shown as follows;

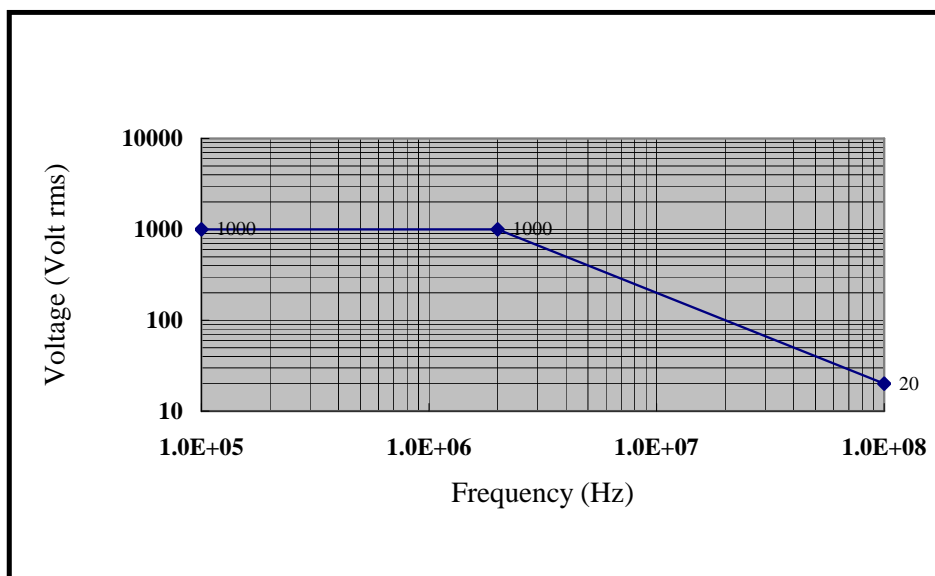

9. Overrange Indicator

The overrange indicator lights red, if the voltage of the input signal exceeds the linear operating range of the probe. When this happens, the signal on the probe output may not accurately represent the signal on the probe input.

10. Inspection Procedure

- a. Connect the BNC output connector to the vertical input of a general purposed oscilloscope.
- b. To install four AA cells or connect an appropriate mains adaptor to this probe.
- c. Set the oscilloscope input coupling to DC and the 1V/div. Center the trace on the display.
- d. Connect the sprung hooks of the probe to power lines.
- e. Set the range of the probe to 1/1000.
- f. Then, a 50Hz/60Hz sine-wave of proper amplitude will be displayed on the screen of the oscilloscope and this means the probe is working properly.

11. Cleaning

Use a soft cloth to clean the dirt. Prevent damage to probe

- a. Avoid immersing the probe.
- b. Avoid using abrasive cleaners.
- c. Avoid using chemicals contains benzene or similar solvents.

Lemo® and Probus® are registered trademarks.

Date: Aug. 30,2006

Headquarter Switzerland:
Pewatron AG
Thurgauerstrasse 66
CH-8050 Zurich
Phone +41 44 877 35 00
info@pewatron.com

Office Germany:
Pewatron Deutschland GmbH
Edisonstraße 16
D-85716 Unterschleißheim
Phone +49 89 374 288 87-0
info.de@pewatron.com



PEWATRON
SENSORS · POWER SOLUTIONS

We are here for you. Addresses and Contacts.

Sales Germany & Austria

Postcode 00000 – 31999
Postcode 38000 – 39999
Postcode 80000 – 99999
Austria

Kurt Stritzelberger

Phone +49 89 260 52 80
Mobile +49 171 803 41 35

kurt.stritzelberger@pewatron.com

Postcode 32000 – 37999
Postcode 40000 – 79999

Gerhard Vetter

Phone +49 674 394 75 75
Mobile +49 163 762 74 30

gerhard.vetter@pewatron.com

Geometrical sensors
Sensor elements

Thorsten Ravagni

Phone +49 60 479 53 627

thorsten.ravagni@pewatron.com

Sales Switzerland & Liechtenstein

Postcode 3000 – 9999

Basil Frei

Phone +41 44 877 35 18
Mobile +41 76 279 37 26

basil.frei@pewatron.com

Postcode 1000 – 2999

Christian Mohrenstecher

Mobile +41 76 444 57 93

christian.mohrenstecher@pewatron.com

Sales International Key Accounts

Peter Felder

Phone +41 44 877 35 05
Mobile +41 79 406 49 83

peter.felder@pewatron.com

Sales Other Countries / Product Management

Pressure Sensors

Philipp Kistler
Phone +41 44 877 35 03
philipp.kistler@pewatron.com

Accelerometers / Level Flow sensor elements

Thorsten Ravagni
Phone +49 60 479 53 627
thorsten.ravagni@pewatron.com

Drive technology CH Postcode 5000 – 9999 / DE

Roman Homa
Mobile +41 76 444 00 86
roman.homa@pewatron.com

Gas sensors / Gas sensor modules Load cells

Dr. Thomas Clausen
Phone +41 44 877 35 13
thomas.clausen@pewatron.com

Power supplies

Sebastiano Leggio
Phone +41 44 877 35 06
sebastiano.leggio@pewatron.com

Drive technology CH Postcode 1000 – 4999 / AT / IT / FR

Christian Mohrenstecher
Mobile +41 76 444 57 93
christian.mohrenstecher@pewatron.com

Flow / Level / Medical products

Dr. Adriano Pittarelli
Phone +49 8245 774 95 44
adriano.pittarelli@pewatron.com

Linear position sensors Angle sensors

Eric Letsch
Phone +41 44 877 35 14
eric.letsch@pewatron.com

Current sensors Power solutions

Osman Coban
Phone +49 71 635 363 898
osman.coban@pewatron.com